

# B Thermal Inspection Report

G



## B Electric Pty.Ltd

Electrical Contractors Licence 5457 A.C.N 010 290 016 A.B.N 24 010 290 016

P.O.Box 2030 Fortitude Valley Qld 4006 Ph:3854 1717 Fax:3252 7728

Email: [robert.shaw@bgbelectric.com](mailto:robert.shaw@bgbelectric.com)

Client and Site Contact	100 Smith St, Brisbane Barry Brown
Location of Equipment	Level 1 Electrical Riser Distribution Board 1
Equipment	3 Pole Circuit Breaker 34,35,36 Blue Phase Cable Connection
Time of Image	10.30 AM
Date of Image	3/3/2017
Report No.	1
Thermographer	Mark Blanch

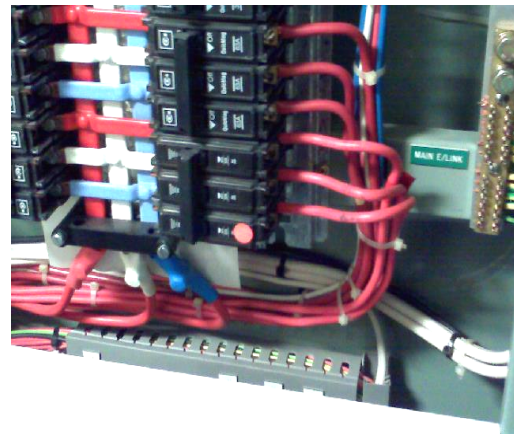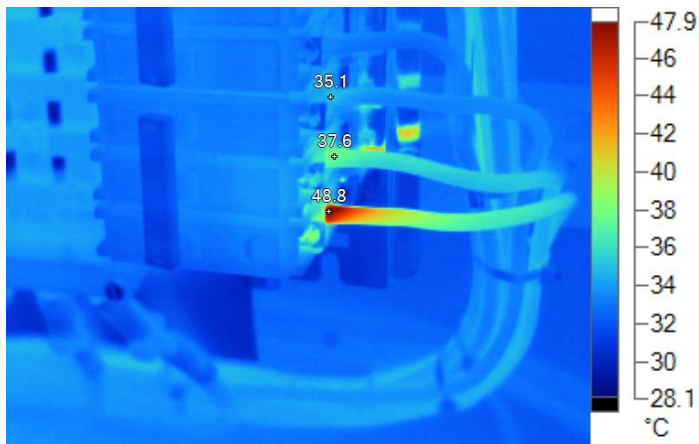

Hot Spot Temperature	48.8°C
Reference Temperature	35.1°C
Thermographers Comments	Heat signature indicates a loose cable connection to Circuit Breaker.
Repair Date / Comments	Reterminated cable and check condition of equipment.
Next Survey Due	March 2018