

B Thermal Inspection Report

G


B Electric Pty.Ltd

Electrical Contractors Licence 5457 A.C.N 010 290 016 A.B.N 24 010 290 016

P.O.Box 2030 Fortitude Valley Qld 4006 Ph:3854 1717 Fax:3252 7728

Email: robert.shaw@bgbelectric.com

Client and Site Contact	100 Smith St, Brisbane Barry Brown
Location of Equipment	Level 2 Electrical Riser Distribution Board 2
Equipment	Tenant Supply Load Shed Contactor "Power"
Time of Image	10.30 AM
Date of Image	3/3/2017
Report No.	3
Thermographer	Mark Blanch

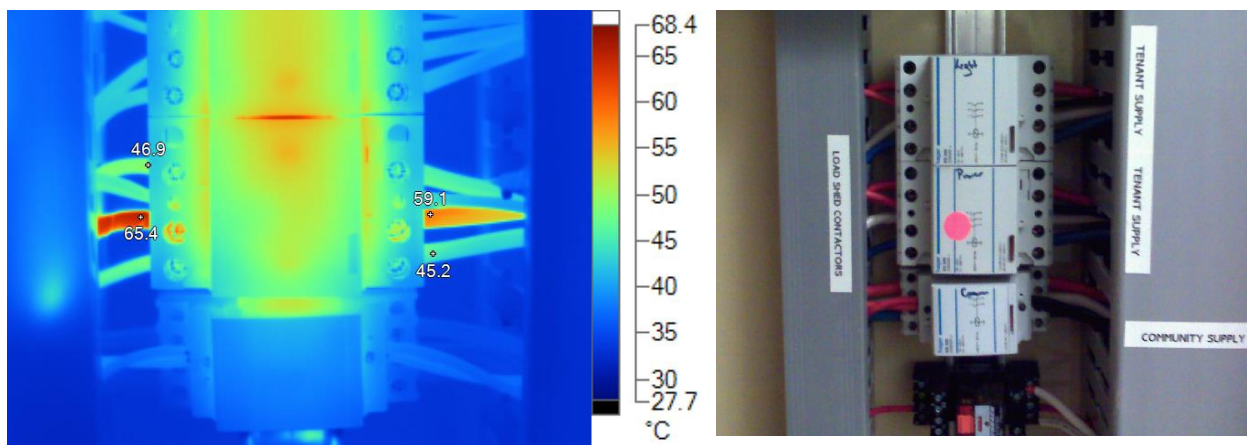

Hot Spot Temperature	65.4°C
Reference Temperature	45.2°C
Thermographers Comments	Heat signature indicates loose cable connections and an unbalanced load. Load at time of inspection was, Red Phase 12 Amps; White Phase 26 Amps; Blue Phase 11 Amps.
Repair Date / Comments	Investigate and re-balance load as required.
Next Survey Due	March 2018